

OMNIPRO

Cummins PCC2100 Hardwire Install Guide



1. Unpack Components

- Unpack the monitor, antenna, and data and power cable.
- Inspect all components to ensure there is no shipping damage.

2. Installing Antenna

- Place the antenna vertically at the center of the roof of the generator.
- Route the antenna cable into the area of the generator control.
- Ensure a drip loop lower than the monitor to prevent water from running down the antenna cable into the monitor connection.

3. Attach the Antenna Cable:

- Attach the antenna cable to the front of the monitor and tighten thumb tight.

4. Attaching the Monitor.

- Attach the monitor via its magnetic feet, on top of the engine controller or another appropriate location.
- Horizontal surfaces are best, but the unit may be mounted vertically or even upside down if necessary.

***Note: If mounted vertically, install the monitor with the cables down to prevent water from entering the enclosure.**

5. Connect the Monitor:

- The monitor can connect to the Cummins PCC2100 via a hardwire connection using the wiring diagram shown below

6. Power On and Check LEDs:

- Turn on the monitor and confirm that the LEDs light up and blink. (Scan QR code for light sequence)
- If not, check for power wires at the battery.

7. Confirm Installation:

- Allow 15 minutes for the monitor to log into the network. Call OmniMetrix at 770-209-0012 to confirm installation.



OMNIPRO

Cummins PCC2100 Hardwire Install Guide

Cummins PCC2100 Wiring Diagram			
SLEEVE COLOR	OMNI WIRE	FUNCTION	TERMINATION
Red	Red	Power In (9-30Vdc)	TB1-17
	Black	Ground	TB1-20
Blue	Orange	Gen Running	TB1-14
	Blue	Common Warning	TB1-8
	Yellow/White	Remote Start	TB1-1
	Brown/White	Remote Stop	TB1-22
White	Pink	Not In Auto	TB1-12
	Brown	Common Shutdown	TB1-10
Alarm Grounds	Daisy chain Terminals 9, 11,13, and 15 to Terminal 20*		

* If connections already exist on these terminals, contact OmniMetrix Technical Support before continuing installation.

If you have any questions, please call OmniMetrix Tech Support at

770-209-0012 or email at techsupport@omnimetrix.net

